


BendPak Technical Service Bulletin 10AP-168 and 10APX-181 Hydraulic Hose Change


BendPak TSB 139-072024 Rev. A1

This TSB describes a change to the current 10AP-168 and 10APX-181 Hydraulic Hoses. Future revisions of the Installation and Operation Manual, 5900265, will be updated to reflect the changes described below:

On all 10AP-168 and 10APX-181 Two-Post Lifts, the very short hydraulic hose $\text{Ø}6.35 \text{ mm} \times 285 \text{ mm}$ (5570174) will be replaced as depicted below. The new Hose Assembly (5570314) removes the elbow JIC fitting and replaces it with a straight JIC fitting.

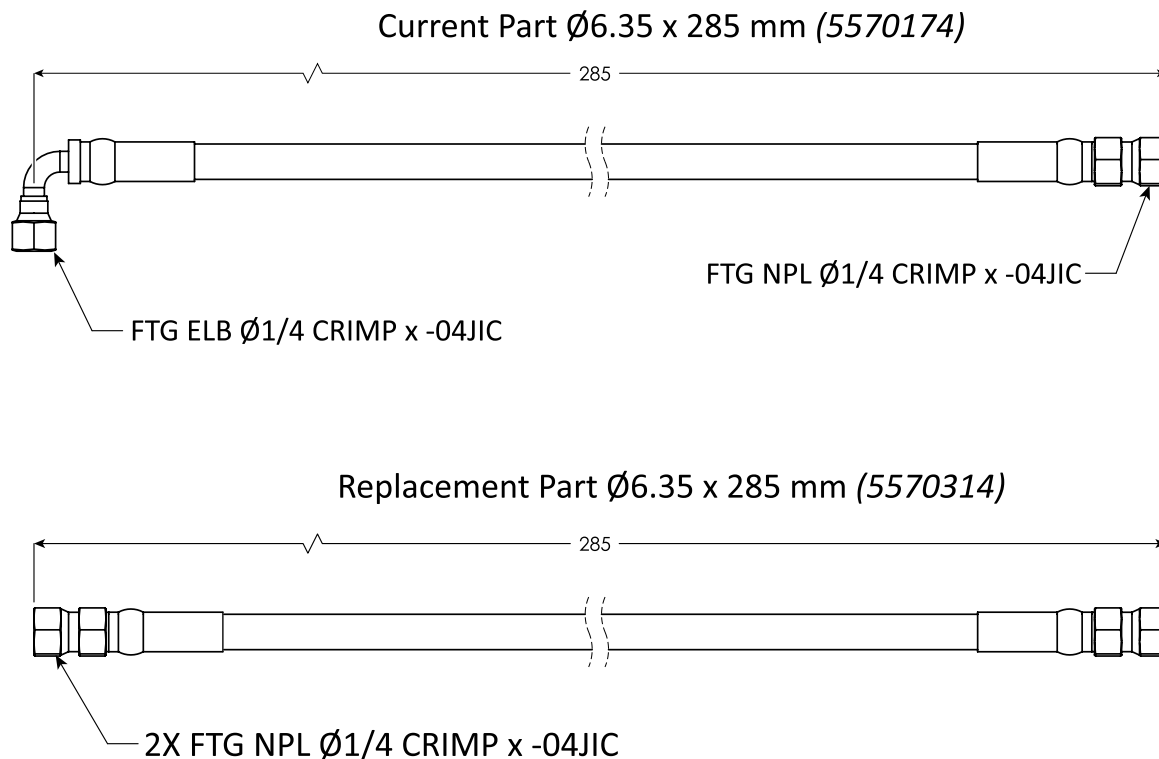

The revised Hose Routing Diagram on the next page details the hose position and fittings required.

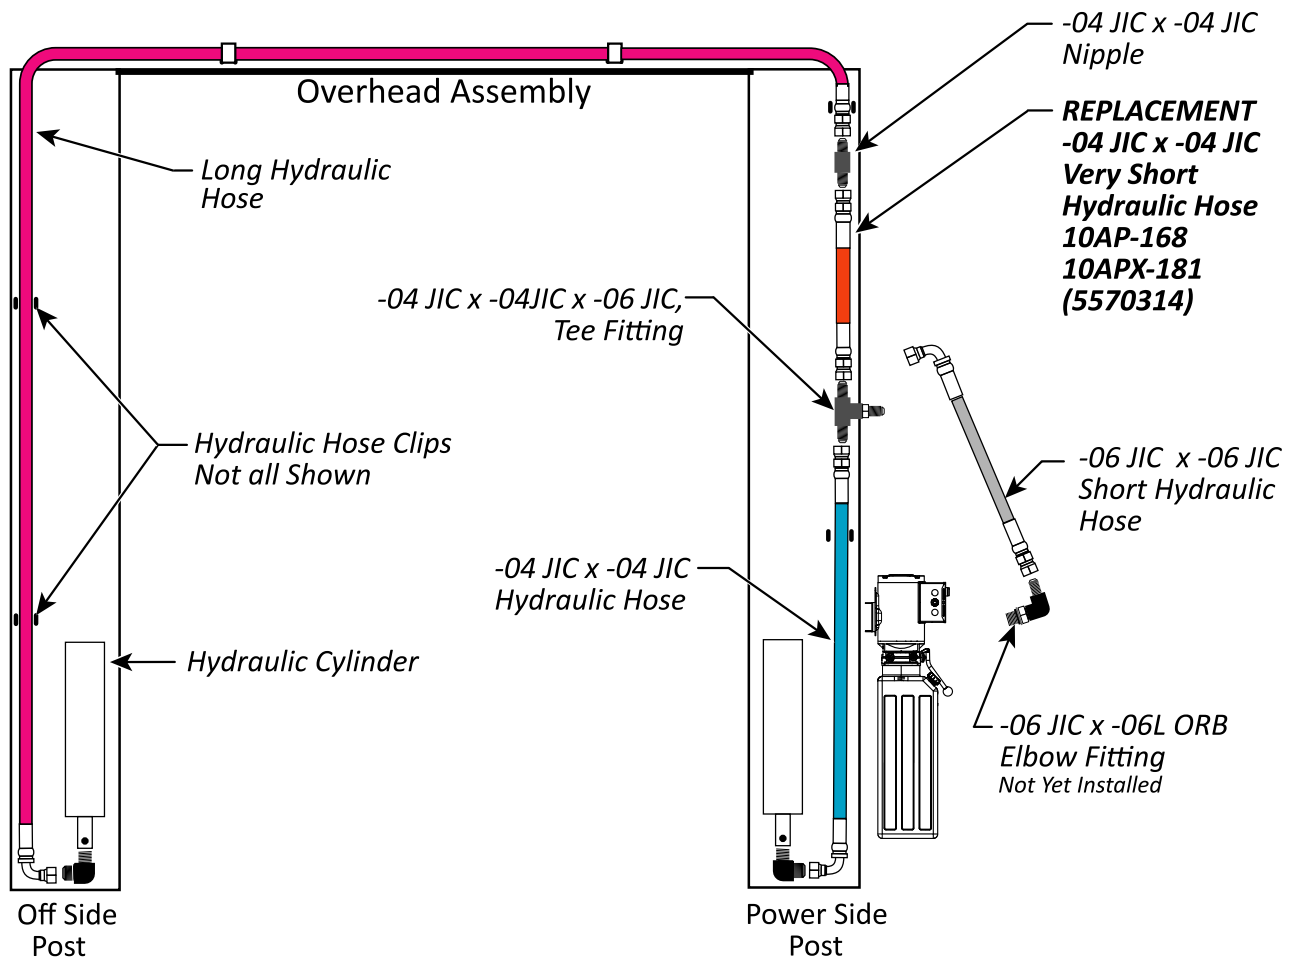

If you experience difficulties with your 10AP Series Two-Post Lift, technical support and service is available from your dealer, on the Web at bendpak.com/support, by email at support@bendpak.com, or by phone at **(800) 253-2363**, follow the prompts to reach service. Online chat is also available at www.bendpak.com