

## BendPak Technical Service Bulletin

### 12AP-SRT Cable and Hydraulic Fitting Substitution

#### BendPak TSB 148-102024


This Technical Service Bulletin describes two component substitutions on the current 12AP-SRT Two-Post Lift. This TSB applies to 12AP-SRT Two-Post Lifts shipped with the Installation and Operation Manual 5900354 Rev. B1.

The first substitution refers to the Equalizing Cables described in pp. 21-26.

The second substitution refers to the Hydraulic Fitting on the Power Unit described on pg. 40.

#### 1. Substitute the Equalizing Cables:

- a. Two Equalizing Cable Assemblies 5595757 Rev. B are included in the 12AP-SRT Parts Box. Remove and discard these two cables, they are undersize.

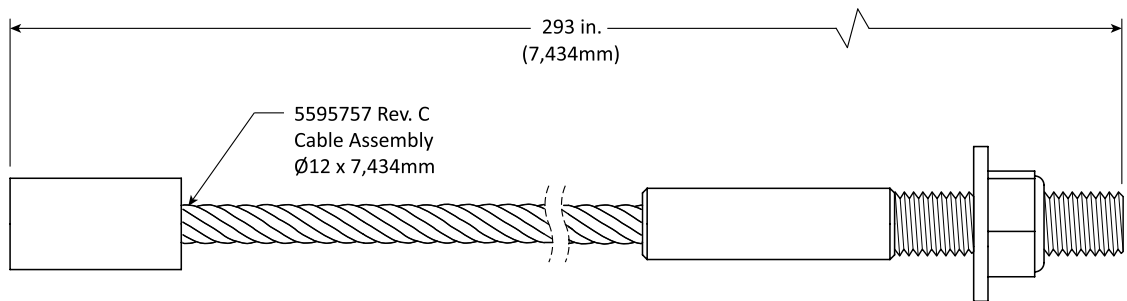

- b. Retrieve the two replacement Equalizing Cables packaged separately 5595757 Rev. C Cable Assemblies (Ø12 x 7434mm ST). These two longer cables will replace the cables discarded in step 1a above. Refer to the figure above. All Equalizing Cable references in the Installation and Operation Manual will refer to the longer cables described in this TSB.
- c. Replace the table on pg. 23 with the table below.


Lift Model	Part Number	Description
10AP-SRT	5595911	Cable Assembly Ø10 x 7,270 mm
12AP-SRT	5595757 Rev. C	Cable Assembly Ø12 x 7,434 mm

Diagram showing two cable assemblies. The left one is labeled 'Button End attaches at the bottom of the Lift Head' and the right one is labeled 'Threaded End attaches at the top of the Lift Head'.


---

## 2. Substitute the Hydraulic Fitting

- a. One Hydraulic Fitting is included in the 12AP-SRT Parts Bag, 5550103 (90-deg. -04 JIC x -06 ORB). Remove and discard this component.
- b. Retrieve the Power Unit Hydraulic Long Elbow Fitting packaged with the Hydraulic Hoses, 5550008 (90-deg. -04 JIC x -06 ORB x 43mm). This longer Hydraulic Elbow will replace the shorter 5550103 fitting discarded in step 2a above.
- c. Refer to the Installation and Operation Manual 5900354 Rev. B1, pg. 40. Substitute the longer 5550008 Fitting for the 5550103.

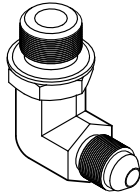

5550103  
FTG ELB -04JIC -06 ORB

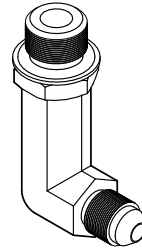

5550008  
FTG ELB -04JIC -06 ORB x 43mm

If you experience difficulties with your 12AP-SRT Two-Post Lift, technical support and service is available from your dealer, on the Web at [bendpak.com/support](https://www.bendpak.com/support), by email at [support@bendpak.com](mailto:support@bendpak.com), or by phone at **(800) 253-2363**, follow the prompts to reach service. Online chat is also available at [www.bendpak.com](https://www.bendpak.com)